

CMS MOTORHOME INSPECTION FORM

General Information

Make & Model	VW Transporter T5 (Cambridge Campervans Conversion)
Reg Number - NO GAP	PK11WZL
HPI Clear	Yes
VAT	No
Engine Size	1.9
BHP	140
Transmission	Manual
Miles or KM	Miles
Mileage	113142
Confirm miles (within 5,000)	Yes
Is Mileage Warranted	Yes
Engine Keys Count	
V5 present	Yes

Engine Bay

Fluid levels correct?	Yes
Oil/Coolant Contamination	No
Engine bay check	Pass

CMS MOTORHOME INSPECTION FORM

Mechanical Inspection

Brake Pedal Pressure Pass?	Yes
Handbrake Test Pass?	Yes
Static Gear Selection Pass?	Yes
Clutch Slip Test Pass?	Yes
Steering Noise	No
Engine noise	No

Test Drive

Test drive - 10 mins	Pass
Engine Lights	No
Engine Lights Info	
Dashboard Ghosting	N/A
Cruise Control Comment	

CMS MOTORHOME INSPECTION FORM

External Inspection

External Extras	Alloys, Parking sensors, Tow bar
Decals	N/A
Decals Further Info	
Any Damage Found	Yes
Damage Further Info	Dent in rear nearside bumper with associated paint crazing towards centre of bumper// Ding in rear nearside door// Scuff on offside lower rear door hinge// 4 tiny dings on drivers door below handle// Slight rusting on bottom of passenger door// Ding in centre of sliding hab door// Paint on bonnet faded.
Windscreen	No damage
Alloy Wheels	Need attention
Alloy Wheels Further Info	Rear nearside wheel needs refurb. Other 3 are ok
Tyres Illegal/Cracking/Out of Date	No
Tyre Further Info	
Damp Floor Underneath	No
Damp Further Info	
Electric Step	N/A
Self Levelling Work	N/A
Pop Top Canvas Damage	No

CMS MOTORHOME INSPECTION FORM

Internal Inspection

Internal Look Original	Yes
Berths	4
Belts	5
Bed Options	Campervan
Lounge Layout	Two Forward Facing
Layout Correct	Yes
Further Comments	No
Further Comments Info	
Internal Extras	Bluetooth, cab A/C, DAB radio, Oven, Part leather, Upgraded stereo
Other Extras	
Electrics Turn On	Yes
Control Panel Damaged	No
Stereo Turn On	Yes
Smell or Signs of Smoking	No
Cushions Correct	Yes
Boiler Present	N/A
Overhead Lockers Ready	Yes

CMS MOTORHOME INSPECTION FORM

Internal Damage & Damp Check

Internal Damage	Yes
Damage Info	Slight wear on rear seat at front & top where belts have rubbed
Damp Visible/Soft	No
Floor Damp/Spongy/Damaged	No
Manuals Present	Yes

Service History

Engine Service History	Full
Service Info	
Cam Belt Changed	Yes
Cam Belt Info	No documentation for cam belt change, but dated on engine
Habitation Service Reports	None
V5 Tested on DVLA	Yes
All Stages Completed	Yes
Completed By	Tim Craner
Sign-off Date	
Price Guide	

CMS MOTORHOME INSPECTION FORM - PHOTOS

V5 Document Photos



Photo 1



Photo 2

CMS MOTORHOME INSPECTION FORM - PHOTOS

Vehicle VIN Photos



Photo 1



Photo 2

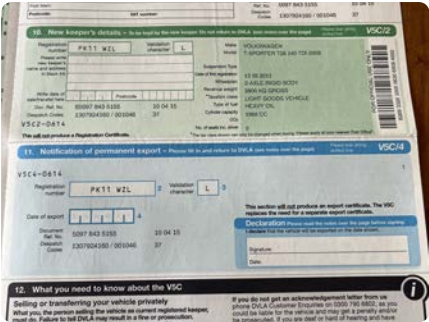


Photo 3

CMS MOTORHOME INSPECTION FORM - PHOTOS

External Damage Photos



Photo 1



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8

CMS MOTORHOME INSPECTION FORM - PHOTOS

Alloy Damage Photos



Photo 1



Photo 2

CMS MOTORHOME INSPECTION FORM - PHOTOS

Internal Damage Photos



Photo 1



Photo 2

CMS MOTORHOME INSPECTION FORM - PHOTOS

Cam Belt Invoice Photo



Photo 1